E-CON

RCB-101-MW

PC Software Operating Manual

8th Edition

IAI America, Inc.

ROBO CYLINDER

Software License Agreement

Thank you for purchasing the PC software for IAI's RC/E-con Controller.

This software is provided strictly with your consent to this agreement. Before opening the software package, please read this Agreement. If you do not agree to any of the terms and conditions specified herein, please return the unopened software to IAI, and we will refund you the purchase price. (Regardless of the reason, opening the software package will be regarded as your acknowledgement of consenting to this Agreement.)

IAI Corporation (hereinafter referred to as "IAI") shall grant to the user (hereinafter referred to as the "User"), and the User shall accept, a non-transferable, non-exclusive right to use the software program supplied with this Agreement (hereinafter referred to as the "Licensed Software"), based on the following terms and conditions.

1. Term of the Agreement

This Agreement shall take effect the moment the User opens the Licensed Software and remain effective until the User submits a termination request to IAI in writing or the Agreement is otherwise terminated pursuant to the provision of Section 5.

2. Right to Use the Licensed Software

The User may use the Licensed Software that has been licensed to the User under this Agreement, on a single computer system (hereinafter referred to as "system") in a machine-readable format. A separate license must be obtained in order to use the Licensed Software on a different system.

The User may not assign, sublicense or transfer to a third party the right to use the Licensed Software granted under this Agreement, the software specified hereunder, or any other item relating thereto, without obtaining a prior written consent from IAI. Unless otherwise specified expressly in this Agreement, the User is not given any right to print or reproduce the Licensed Software in whole or in part.

3. Duplication of the Licensed Software

The User may not duplicate any part of the documentation provided by IAI in accordance with this Agreement. Creation of a duplicate of the Licensed Software provided by IAI in a machine-readable format shall be permitted solely for the purpose of backing up the software.

4. Protection of the Licensed Software

The User may not provide the Licensed Software to any individual other than the employees of the User or IAI, without obtaining a prior written consent from IAI.

5. Termination of the Agreement

In the event of breach by the User of any of the terms and conditions hereunder, or upon discovery of a material cause that makes continuation of this Agreement impossible, IAI may immediately terminate this Agreement without serving any prior notice to the User. If the Agreement is terminated for the above reason, the User must destroy the Licensed Software received from IAI and all duplicates thereof within ten (10) days after the lapse of the Agreement and send a confirmation of said destruction to IAI.

6. Scope of Protection

IAI reserves the right to change any and all specifications relating to the Licensed Software without prior notice. IAI shall make no warranty whatsoever with respect to the Licensed Software. The User agrees not to claim compensation for damage from IAI for any loss suffered by the User as a result of installing the Licensed Software in the User's system.

ROBOCYLINDER

Supported Models

The PC software RCB-101-MW supports the following controller models of the specified versions and later.

Model name	Supported versions (For each model, all controllers of the specified version and later are supported.)
RCP	V1.0.0.0
RCS	V3.0.0.0
E-Con	V3.0.5.0
RCP2	V4.0.0.0
ERC	V4.0.0.0

Table 1 List of Supported Models

* <u>Please check the controller model and the version of this application. If the controller is not supported by</u> the software, the actuator may behave erratically.

The software reset function and velocity/current monitor function are effective on the controllers of version 4.0.0.0 or later.



A Word of Caution

E-Con

- [1] This software is copyrighted by IAI Corporation (IAI).
- [2] This software and the accompanying manual may not be used or duplicated in part or in whole without a permission of IAI.
- [3] A separate software program must be purchased for each PC in which it is run.
- [4] The software and the manual can only be used under the terms and conditions of the license agreement.
- [5] We cannot assume responsibility for any damage or loss resulting from the use of this software or the manual.
- [6] Please note that the version or edition number printed on the face of this manual does not correspond to the software version number.
- [7] The content of this manual is subject to change without notice.
- [8] This software runs on Windows 95, Windows 98, Windows NT, Windows Me, Windows 2000, or Windows XP (this software does not contain Windows). This manual is written on the assumption that the user already has a basic understanding of Windows operations.

Microsoft, MS, MS-DOS, Windows, Windows 95, Windows 98, Windows NT, Windows Me, Windows 2000, and Windows XP are registered trademarks of Microsoft Corporation in the U.S.A.

Copyright 1995 July. IAI Corporation. All rights reserved.



Table of Contents

1.	Bef	ore You Begin	1
1 1 1	-1 -2 -3 -4 -5	Items Supplied with This Software What You Will Need (System Requirements) Installing the Software Starting the Software Setting of Application Window	1 2 2
2.	Che	ecking for Connected Axes	4
3.	Mai	in Window	5
	3-1 3-2 3-3 3-4	Operating from the Main Menu Operations Using the Toolbar Buttons Tree View Status Bar	8 9
4.	Sel	ecting an Axis1	1
5.	Edi	ting Position Data1	2
	5-1 5-2	Online Mode	
6.	Edi	ting Parameters2	2
7.	Мо	nitoring2	4
7	7-1 7-2 7-3 7-4	Status Monitor Window 2 Controller Error List 2 Velocity/Current Monitor Window 2 Setting of Application Window 2	25 26
8.	Ver	sion Information	0
9.	File	Extensions	1



1. Before You Begin

1-1 Items Supplied with This Software

Please check to make sure that the following items are included in your software package.

- [1] Operating manual
- [2] 1 CD containing the software
- [3] Software license agreement (explanation sheet)
- [4] External connection unit (PC cable with RS485 adapter)

1-2 What You Will Need (System Requirements)

The following PC and peripherals will be necessary to run this software program.

- PC and compatible keyboard
 A PC *1 (DOS/V specification) running Windows and a compatible keyboard.
 (*1: Personal computer. Abbreviated as "PC" throughout this manual.)
- [2] Memory Enough memory to run Windows.
- [3] Monitor
 A monitor *1 compatible with the PC.
 (*1: May be referred to as "CRT" in this manual.)
- [4] Graphics board A VGA graphics board or better. (Use of a XGA graphics board or better is recommended.)
- [5] Mouse or other pointing device and mouse driver A mouse or other pointing device with which you can operate this software comfortably, and an applicable driver.
- [6] Windows Windows 95, Windows 98, Windows NT, Windows Me, Windows 2000, or Windows XP
- [7] CD ROM Drive A CD drive unit that reads compact disks.
- [8] Hard disk The hard disk should have 4 MB or more of free disk space. (The software is run from the hard disk.)

BROBO CYLINDER E-CON

[9] Serial port

An RS232C serial port. (Only a 9-pin port is supported.)

[10] Printer A printer compatible with the PC.

1-3 Installing the Software

This software is run from the hard disk. This section explains how to install the software.

- [1] Insert the compact disk into the CD ROM drive.
- [2] Double-click Setup.EXE in disk 1.
- [3] The installation program will start. Follow the onscreen prompts to select the applicable installation options.
- [4] When the installation program ends, an item named "RoboCylinder" will be created in the **Programs** list displayed from the **Start** menu. This software will launch when **RoboCylinder** is selected.

1-4 Starting the Software

- [1] Turn off the power to the controller and connect the controller to the PC using the external connection unit that comes with the software.
- [2] Turn on the power to the controller.
- [3] Set the port switch on the controller to ON, and start the software.
 - * This software determines whether it is in the online mode or offline mode based on whether or not the controller and PC are connected when the software is started. The software will not switch to the online mode if the port switch on the controller is set to ON after the software has been started with the port switch set to OFF. To switch the software to the online mode when it is running in the offline mode, use the "Reconnect" function (refer to 3-1 (5) [2], "Controller Setup").
- [4] When the "Check for connected axes" window appears, wait for the software to complete the check. Then, enter appropriate information to set up the software in accordance with the configuration of your system.

The "Setting of application" window (Fig. 1) is displayed only once after the software has been installed for the first time. (Refer to the next page.)



1-5 Setting of Application Window

The "Setting of application" window (Fig. 1) is displayed only once after the software has been installed for the first time. In this window, set the information the software needs to communicate with the controller.

E-Con

Setting of application	×			
Port	-Baudrate (bps)			
⊙ COM1 C COM5	C 9600 C 38400			
С СОМ2 С СОМ6	C 14400 C 57600			
С СОИЗ С СОИ7	○ 19200 ④ 115200			
С СОМ4 С СОМ8	C 28800			
Last axis # 15 - (The new settings will be effective after resetting or cycling power.)				

Fig. 1 Setting of Application Window

[1] Port

From the list, select the serial port to be used to communicate with the controller.

- [2] Baudrate (bps)
 - From the list, select the baudrate the software will use when communicating with the controller.
 - * The baudrate selected here is used only in the communication between this application and controller. It does not affect the communication speed parameters of the controller.

[3] Last axis

Select the axis number of the last axis to be checked for connection.

* Axes of numbers greater than the value selected here will not be checked for connection. Select an appropriate axis number after checking the axis numbers of the connected axes.

After setting the above items, click **OK**. The specified axes will be checked for connection. (The next time you start the software, connected axis check will be performed automatically based on the settings you have just specified.)

* These settings can be changed in the "Setting of application" window (Fig. 7.6). If **Cancel** is clicked, the application will end without checking for connected axes. (The next time you start the software, the "Setting of application" window will be displayed again.)



2. Checking for Connected Axes

The software checks for connection all axes up to the axis specified in the **Last axis #** box of the "Setting of application" window (Fig. 1 or 7.5).

After the check, "(Connecting)" will be shown for those axes whose connection has been confirmed, while "-" will be shown for all other axes.

E-Con

Check for connected axes		
Axis No.	Status	
0	(Connecting)	
1	_	
2	-	
3	(Connecting)	
4	_	
5	-	
6	_	
7	-	
8	_	
9	_	
10	_	
11	_	
12	(Checking)	
13	(Checking)	
14	(Checking)	
15	(Checking)	

Fig. 2.1 Check for Connected Axes Window (Checking for Connection)

Check for connected axes		
Axis No.	Status	
0	Connected	
1	_	
2	_	
3	Connected	
4	_	
5	_	
6	_	
7	_	
8	_	
9	_	
10	_	
11	_	
12	_	
13	_	
14	_	
15	-	

Fig. 2.2 Check for Connected Axes Window (Connection Check Completed)



3. Main Window

PC Interface Software for RC/E-Con	_ 8 ×
File Position Parameter Monitor Setting Window Help	
X Position data Parameter Status monitor CTL error list Velocity/Current Status monitor CTL error list Velocity/Current Velocity/Current	
	Port : COM1 Baudrate : 115200[bps]

Fig. 3.1 Main Window

You can select the following items from the main menu or toolbar available in the main window (Fig. 3.1).

3-1 Operating from the Main Menu

- (1) File
 - [1] [New] Create new position data.
 - [2] [Open] Load position data or parameters from a file.
 - [3] [Close] Close the active file.
 - [4] [Send to Controller] (Available in the online mode) [Position Data] Write position data in a file to the controller. [Parameter] Write parameters in a file to the controller.



- [5] [Backup] (Available in the online mode)
 [Save from Controller to File]
 Save all position data and parameters in the controller to a file.
 [Send from File to Controller]
 Send all position data and parameters in a file to the controller.
- [6] [Exit] Exit this application.

(2) Position (Available in the online mode)[1] [Edit/Teach]

Load position data from the controller for editing or use in teaching.

- [2] [Send to Controller] Transfer (write) edited position data to the controller.
- [3] [Print] Print the position data you are currently editing.
- (3) Parameter (Available in the online mode)
 [1] [Edit]
 Load parameters from the controller for editing.
 - [2] [Send to Controller] Transfer (write) edited parameter to the controller.
 - [3] [Print] Print the parameter you are currently editing.
- (4) Monitor (Available in the online mode)[1] [Status]

You can check the various statuses of each axis (axis status, internal flags and I/O ports).

E-Con

- [2] [CTR Error List] Display the CTR error list window.
- [3] [Velocity/Current]

Display the velocity/current monitor window.

- * This menu item is available only when the controller supports the velocity/current monitor function. Refer to "Supported Models."
- (5) Setup
 - [1] [Application Setup]

Set up the application (baudrate and ports).



[2] [Controller Setup] Reconnect:

Reconnect the axes.

If the software connects to multiple controllers linked by controller link cables, always select **Reconnect** after turning off and then on again the power to a connected controller to which the teaching pendant is not connected directly.

E-Con

Assign Axis Number: Set the axis number for an integrated controller. This menu item does not do anything for a separate controller.

Reset Software: Reset (restart) the software.

* This menu item is available only when the controller supports the software reset function. Refer to "Supported Models."

- (6) Window
 - [1] [Cascade] Rearrange all open windows in such a way that they are cascaded (staggered) on top of each other.
 - [2] [Tile Vertical] Rearranges all open windows as vertical tiles.
 - [3] [Tile Horizontal] Rearranges all open windows as horizontal tiles.
 - [4] [Arrange lcons] Arrange all window icons (minimized windows).
 - [5] [Minimize All] Minimize all open windows.
 - [6] [Maximize All] Restore all window icons (minimized windows) to their original size.
 - [7] [Tree View] Show/hide the tree view (Fig. 3.4).
- (7) Help
 - [1] [Help]
 - Display the help files.
 - [2] [About] Display the version information of this application.
- * The menu items shown in gray cannot be selected.



3-2 Operations Using the Toolbar Buttons

 


Fig. 3.2 Toolbar Buttons

- [1] New position data Same as clicking **File**, pointing to **New**, and then selecting **Position Data**.
- [2] Open file Same as clicking **File**, and then selecting **Open**.
- [3] Edit/teach position data Same as clicking **Position**, and then selecting **Edit/Teach**.
- [4] Edit parameters Same as clicking **Parameter**, and then selecting **Edit**.
- [5] Monitor Same as clicking Monitor, and then selecting Status.
- [6] CTR Error list Display the CTR Error list window.
 Same as clicking Monitor, and then selecting CTR Error List.
- [7] Velocity/current Display the velocity/current monitor window.
 Same as clicking Monitor, and then selecting Velocity/Current.
- [8] Reconnect Same as clicking Setup, pointing to Controller Setup, and then selecting Reconnect.
- [9] Save all data Same as clicking File, pointing to Backup, and then selecting Save from Controller to File.
- [10] Send all data Same as clicking **File**, pointing to **Backup**, and then selecting **Send from File to Controller**.

* The menu items shown in gray cannot be selected.



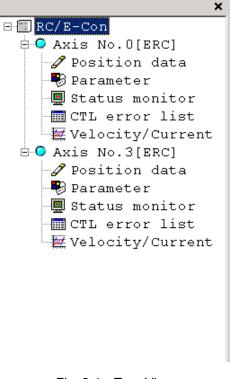


Fig. 3.3 Toolbar Buttons

- [1] Cascade windows Same as clicking **Window**, and then selecting **Cascade**.
- [2] Tile windows vertically Same as clicking **Window**, and then selecting **Tile Vertical**.
- [3] Tile windows horizontally Same as clicking **Window**, and then selecting **Tile Horizontal**.

3-3 Tree View

From the main menu, click Window, and then select Tree View.



E-Con

Fig. 3.4 Tree View


[1] Axis No. 0 [ERC]

Axis No. 8 [RCP]
 The axis number of each axis and the corresponding controller model are shown.
 A light blue icon is shown if the controller is normal. If the controller is in an error state, a red icon is shown.

EROBO CYLINDER E-Con
[2] Position data You can double-click this item to open the position data edit window.
[3] Parameter You can double-click this item to open the parameter edit window.
 [4] Image: Status monitor You can double-click this item to open the status monitor window.
[5] Image: CTR error list You can double-click this item to open the CTR error list window.
[6] Welocity/Current You can double-click this item to open the velocity/current monitor window.
* The specific tree view will vary depending on the model of the connected controller.

3-4 Status Bar

	2	3
Continuous move	Port : COM1	Baudrate : 115200[bps]

 

[1] Tool tip

Bringing the mouse cursor over a toolbar button will display the tool tip on the button.

[2] Port name

The serial port currently in use is indicated.

[3] Baudrate

The baudrate (bps) of the current communication is indicated.



4. Selecting an Axis

To perform any of the following operations, select the axis number of the target axis in the "Select axis number" window (Fig. 4.1).

- [1] Open the position data edit window in the online mode. (Note)
- [2] Send position data edited in the offline mode to the controller. (Note)
- [3] Open the parameter edit window in the online mode. (Note)
- [4] Send parameters edited in the offline mode to the controller. (Note)
- [5] Open the monitor window from the main window.
- [6] Save all data. (Note)
- [7] Send all data (Note)
- [8] Open the controller error list window.
- [9] Open the velocity/current monitor window.
- [10] Reset the software.

Before the software switches to the applicable mode in each of the above operations, the "Select axis number" window appears.

The axis numbers corresponding to the operable axes are shown in the box under **Connected axes**. Move the cursor to the axis you want to operate, click \ge to select the axis, and then click **OK**. To select all axes, click, \gg and then click **OK**.

Select axis number		×	
Please select axis number. (The axis editing the position data or the parameter is not displayed.)			
Connected axes	> < << OK	Selected axes	
Fig. 4.1 Select	Axis Nu	Imber Window	

Note: The axes for which the "position data edit window" or "parameter edit window" is currently open in the online mode are not shown. To select any such axis, close the applicable edit window first.



5. Editing Position Data

You can edit position data in the online or offline mode.

5-1 Online Mode

In this mode, data can be loaded from the controller for editing. (Fig. 5.1) Click **Position** and then select **Edit/Teach** from the main menu, or click **i** in the toolbar. In the "Select axis number" window, select the axis number corresponding to the axis whose position data you want to edit. Refer to 4, "Selecting an Axis."

E-Con

In the online mode, you can create position data by "MDI (Mathematical Direct Input)," "Direct Teaching," "Jogging" or "Inching" operation.

Created/edited position data will become effective after it has been sent to the controller.

To send position data to the controller, click **Position** and then select **Send to Controller** from the main menu, or click in the position edit window.

You can also check the teaching positions in two test operation modes: "Positioning" and "Program."

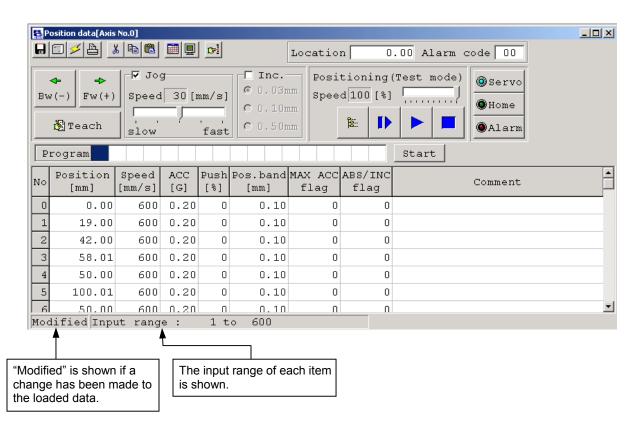


Fig. 5.1 Position Edit Window (Detail Window in Online Mode)

* While the position edit window of a given axis is open in the online mode, the parameter edit window of the same axis cannot be opened. (You can open the parameter edit window of any other axis.)



The operating methods of buttons and input controls available in this window are explained below.

(1) Toolbar buttons



Fig. 5.2 Toolbar in Position Data Edit Window

- [1] Save to file Save data to a file.
- [2] Send to controller Send (write) data to the controller.
- [3] Reload position data

Reload position data from the controller and then refresh the displayed data.

If the position data has been changed in the edit window (when "Modified" is shown in the status bar), clicking this button will display the warning message shown in Fig. 5.3.

* Take note that if you select **Yes** in this window, data that have been edited but not yet been written to the controller will be lost.

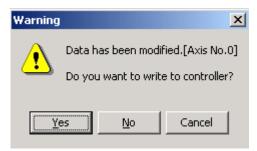


Fig. 5.3 Warning Message

[4] Print

Output position data to the printer.

[5] Cut

Cut the range of data selected in the position data input area and save it to the clipboard. * You can select data in units of rows.

[6] Copy

Copy to the clipboard the range of data selected in the position data input area. * You can select data in units of rows.

[7] Paste

Paste the data in the clipboard to the selected position.



[8] Switch display Change the display mode of the position data input area from normal to detail (or vice versa). (Fig. 5.14, Fig. 5.15)

E-Con

[9] Show monitor window

Display the status monitor window of the axis you are currently editing. This window is the same as the one you can open by selecting **Status** from **Monitor** in the main menu of the main window.

[10] Divide position data equally

Clicking this button will display the window shown in Fig. 5.4.

Set appropriate values in **Start Position No.** and **End Position No.**, select an appropriate option under **Fraction processing**, and then click **OK**. The distance between the specified two positions will be divided equally. (This function is called "Equal division function")

- * Clicking this button while multiple rows are selected in the position data input area will cause the software to automatically populate the **Start Position No.** and **End Position No.** field.
 - Start Position No.: First position in the selected range End Position No.: Last position in the selected range

Divide the position data at equal i 🗙
Start Position No. 🧧
End Position No. 7
Fraction processing
• Round off
C Round up
C Round down
OK Cancel

Fig. 5.4 Divide Position Data at Equal Intervals Window

If data has been input between the specified two positions, the warning message in Fig. 5.5 will be displayed.

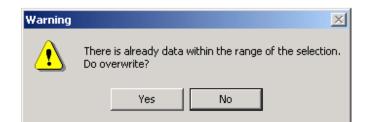


Fig. 5.5 Warning Message

E ROBO E-Con

The input fields of position data generated by the equal division function, other than **Position** and **Comment**, will be populated by the corresponding values for the position specified in **Start Position No.** The **Comment** field will be cleared.

* The equal division function can also be implemented from the pop-up menu (Fig. 5.6) displayed by right-clicking the position data input area.

Insert position data at cursor location Delete position data at cursor location Clear position data at cursor location

Divide at equal intervals

Fig. 5.6 Pop-up Menu



(2) Current position/alarm code

The current position of the axis you are editing (unit: mm) and the associated alarm code, if any, are shown.

E-Con⁻



Fig. 5.7 Current Position/Alarm Code

(3) Jogging/inching operation controls

Select **Jog** or **Inc.** (by adding a check mark to the corresponding checkbox) and use the **Fw (+)/Bw (-)** buttons to move the axis.

Select the jogging speed from "1," "10," "30," "50" and "100" [mm/sec] using the track bar.

In the inching mode, select the feed pitch from "0.03," "0.10" and "0.50" [mm] using the applicable radio button.

A click will move the axis by the specified pitch, while holding down the mouse button will cause the axis to jog at 1 mm/sec after 1 second. If the mouse button is held continuously, the jogging speed will increase from "10" to "30" and to "100" [mm/sec] every second.

If homing has been completed, clicking **Teach** will load the current position to the point data input area.

* In the position data input area, the loaded data will be input to the row where the cursor is located. Check the cursor position before clicking **Teach**.

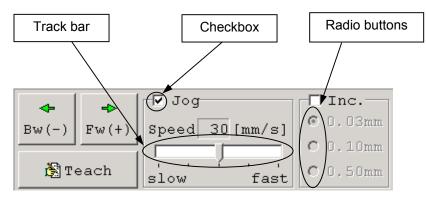


Fig. 5.8 Jogging/Inching Operation Controls

(4) Positioning (test operation mode)

You can move the axis to the position corresponding to the cursor row in the position data input area. The moving speed is calculated by multiplying the speed set in the position data input area with the speed factor. (The speed factor can also be set by the track bar.)

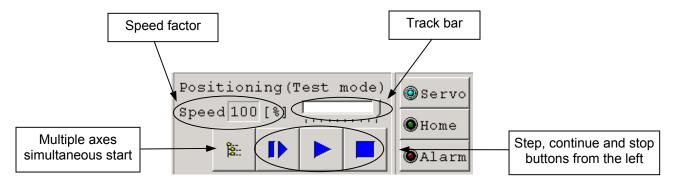


Fig. 5.9 Positioning



axis to move continuously by looping within the block of specified position data. Clicking again while the axis is moving continuously will stop the axis when it reaches the next position. Clicking will stop the axis (the axis will start decelerating the moment the button is clicked and continue to decelerate until it finally stops.)

- * If the data loaded from the controller has been changed, write the modified data again to the controller beforehand.
- * While this mode is active, data cannot be entered in the jogging/inching control groups or point data input area.

Simultaneous movement of multiple axes

Multiple axes simultaneous start button

You can use this button to simultaneously move the selected axes, from among the multiple axes currently connected by link cables.

Click the multiple axes simultaneous start button in the positioning setting area.



Fig. 5.10 Multiple Axes Simultaneous Start Button

The "Start multiple axes simultaneously" window will open.

	Axis number	-		Г	- Position
Checkbox] s	itart i	multiple	e axis simulta	aneously X
Checkbox		\neg		Position	Location
		H.		PUSICION	77.11
		╞	0		(7.11
		╞	1		
		Ē	2		
		Ľ	3		
			4		
			5		
			6		
			7		
			8		
		Г	9		
		Г	10		
		Г	11		
		Г	12		
		Г	13		
		Г	14		
		Г	15		
				D	

Fig. 5.11 Start Multiple Axes Simultaneously Window

ROBO CYLINDER	E-Con

Checkbox:	The axes with a check mark in this box will move. The selectable checkboxes are those of axes whose point edit window is currently open.
Axis:	Axis number.
Position:	Set a position number in one field. This position determines the movement range for each specified axis based on a routine similar to continuous movement, and the axis will move over the determined range. All selected axes will move to this position. (If no position data is set, the axes will not move.)
Location:	The current position of each axis is shown.
Step movement button:	Clicking this button will move the axes to the next position and complete the movement.
Continuous move button:	Move the axes continuously. If this button is clicked during continuous movement, the axes will stop moving after they have reached the current positions.
Stop button:	Clicking this button will cancel the current movement and stop the axes on the spot.

Example of use) When the "Start multiple axes simultaneously" window is set as shown in Fig. 5.11 and position data for each axis is set as follows

Axis number Position	0	1	2	3
0	0.00	0.00	0.00	0.00
1	25.00	*	*	10.00
2	∧ 10.00	∧ 30.00	60.00	A 20.00
3	75.00	40.00	20.00	80.00
4	V *	V 50.00	30.00	V 40.00
5	*	*	50.00	10.00
6	*	*	40.00	25.00

Clicking (continuous move) will move the actuators as follows.

	Axis number 0	Axis number 1	Axis number 2	Axis number 3	
\mathbb{Z}	75.00	40.00	Does not move.	80.00	
	$\overline{\mathbf{v}}$	\checkmark	$\overline{\nabla}$	$\overline{\nabla}$	
	Does not move.	50.00	Does not move.	40.00	
	$\overline{\mathbf{v}}$	$\overline{\nabla}$	$\overline{\mathbf{v}}$	$\overline{\nabla}$	
	10.00	30.00	Does not move.	20.00	
			l		

After all specified axes have completed their movement, they will move to the next positions.

- The actuator corresponding to axis number 2 does not move, because its checkbox is not selected.
- The actuators do not move if position data is not set for the corresponding axes.



(5) Program

Just like positioning, this is also a test operation mode. In the program mode, however, you can set a desired sequence of movement. In the position number input area, enter position numbers (0 to 15) or "R" (a symbol specifying a repeat of the preceding numbers), and then click **Start**.

E-Con⁻

Up to 17 steps can be specified, including "R.'

If a blank field exists, all subsequent steps are considered invalid. All steps after "R" are also considered invalid.

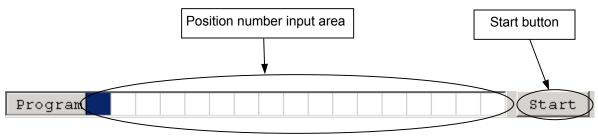


Fig. 5.12 Program Mode

Clicking **Start** will start the specified movement, and the button text will change to "Stop." The button text will change back to "Start" when the movement ends or the button is clicked again. The sequence set in the program mode will not be saved to the controller or a file.

(6) Servo, Home and Alarm buttons



Fig. 5.13 Servo Home and Alarm Buttons

- Servo button
 This button lets you turn on/off the servo.
 When the servo is on, a blue lamp illuminates on the button.
 After homing, you can turn off the servo, move the actuator manually and then click **Teach** to capture a desired position.
- Note: Closing the software when the servo is off will keep the servo in the off state, thus disabling the PIO operation. To reset the servo, restart the software with the controller connected, or reconnect the controller power.
- [2] Home button

This button lets you perform homing. Once homing is complete, a green lamp will illuminate on the button.



[3] Alarm button

This button lets you reset an alarm. Note that an alarm can be reset only when the servo is off and the cause of the alarm has been removed.

While an alarm is present, a red lamp remains lit on the button.

(7) Position data input area

Enter position data in this area.

Normally, you can enter in the **Position**. **Speed**, **ACC** and **Comment** fields. By switching to the detail mode by clicking the display switching button ()), the **Push**, **Pos. band**, **MAX ACC flag** and **ABS/INC flag** fields will appear where you can enter the applicable data.

E-Con[–]

No	Position [mm]	Speed [mm/s]	ACC [G]	Comment
0	5.00	125	0.30	
1	50.00	125	0.30	
2	10.00	50	0.30	
3				
4				
5				
6				•

Fig. 5.14 Position Data Input Area (Normal Mode)

No	Position [mm]	Speed [mm/s]		Push [%]	Pos.band [mm]	MAX ACC flag	ABS/INC flag	Comment
0	10.00	125	0.30	0	0.10	0	0	
1	50.00	125	0.30	50	5.00	0	0	
2	10.00	50	0.30	0	0.10	0	1	
3								
4								
5								
6								×

Fig. 5.15 Position Data Input Area (Detail Mode)

* ABS/INC flag: Select absolute coordinate specification or incremental coordinate specification. 0: Absolute coordinate specification

1: Incremental coordinate specification



5-2 Offline Mode

When editing data after creating new data or loading data from a file, you are editing the data in the offline mode.

In this mode, the screen controls relating to axis operation are grayed out, and only the toolbar and point data input area become active.

Once data has been edited, you can save the data to a file or send it to the "connected" controller.

* The **Comment** field can only be saved to a file. It cannot be saved to the controller.



6. Editing Parameters

To load parameter data from the controller, click **Parameter** and then select **Edit** from the main menu, or click in the toolbar. In the "Select axis number" window, select the axis number corresponding to the axis whose parameters you want to edit. (Refer to 4, "Selecting an Axis.")

IE-Con⁻

You can load data from the controller or a file and edit the loaded data.

You can also print the loaded data.

Edited data can be sent to the controller or saved to a file.

Edited parameters that have been sent to the controller will become effective after the controller power is reconnected.

To send data to the controller, click **Parameter** and then select **Send to Controller** from the main menu, or click in the toolbar of the parameter edit window.

Ð		
No	Name	Value
1	Zone Output Position + [mm]	45.00
2	Zone Output Position - [mm]	20.00
3	Soft limit + [mm]	100.31
4	Soft limit - [mm]	-0.30
5	Home direction [0:opposite/1:default]	1
6	Push recognition time [msec]	255
7	Servo gain selection	11
8	Default speed [mm/sec]	600
9	Default ACC/DCL [G]	0.20
10	Default position band [mm]	0.11
11	Default MAX ACC(G) flag	0
12	Default positioning current limit [%]	35
13	Default home current limit [%]	35
14	(For future expansion)	0
15	Disable 'STOP' Input [0:Enable/1:Disable]	0
16	SIO Baudrate[bps]	38400
17	Min delay for activating local transmitter[msec]	5
18	(For future expansion)	0
19	(For future expansion)	0
20	(For future expansion)	0
21	(For future expansion)	1
22	Home offset[mm]	2.00
23	(For future expansion)	100.31
24	(For future expansion)	-0.30
25	PIO pattern	0
26	(For future expansion)	100
27	Move command type[0:Level/1:Edge]	0

Fig. 6.1 Parameter Edit Window




Depending on the controller model, a confirmation window (Fig. 6.2) may be displayed after parameters have been sent to the controller, asking if you want to restart the controller (reset the software). (This window appears only when the controller to which data has been written supports the software reset function. Refer to "Supported Models.")


E-Con

Confirma	tion	×
?	Restart the controlle	:r?
Yes	; No	

Fig. 6.2 Controller Restart Confirmation Window

 • If you want to change the soft limits, set values corresponding to 0.3 mm outside of the desired effective range.



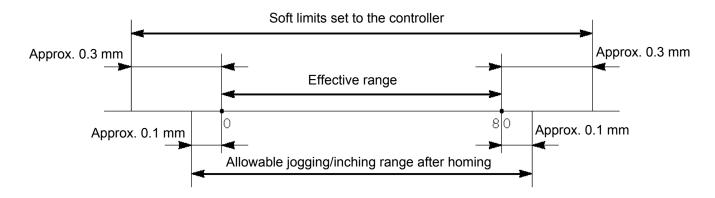

- If the homing direction is changed, all position data currently input will be cleared. Before changing the homing direction, therefore, back up the data, if necessary.
- The homing direction cannot be reversed for RPA rod-type actuators only.

Note: After parameters have been changed, reconnect the controller power or reset the software (if the controller supports the software reset function). Parameters will be rewritten simply by turning the emergency stop switch or PORT switch to OFF and then ON again, but the new value may not become effective depending on the parameter.

ROBO CYLINDER

7. Monitoring

You can monitor various statuses, controller error list, and velocity/current waveforms (only if the controller supports the function).

7-1 Status Monitor Window

To monitor various statuses, click **Monitor** and then select **Status** in the main menu, or click **I** in the toolbar. In the "Select axis number" window, select the axis number corresponding to the axis whose statuses you want to monitor. (Refer to 4, "Selecting an Axis.") (Fig. 7.1 shows an example of the display when a RCP2 controller is connected. The displayed information will vary depending on the controller type.)

E-Con

Axis status	Internal flags		
Location	Power: Main controller power ON/OFF status		
Speed (moving speed)	Servo: Servo command status		
Alarm code	Home Cmplt: Homing completion flag ON/OFF status		
	Run: Actual servo status		
Inputs	Outputs		
The ON/OFF status of each PIO input port is shown.	The ON/OFF status of each PIO output port is shown.		

Display ON/OFF button (corresponding to the **Axis status**, **Internal flags**, **Inputs** and **Outputs** groups, respectively)

	Status monitor[A	xis No.0]	
\langle		>	
	Axis status		Internal flags
	Location (mm)	0.00	Power Servo
	Speed (mm/s)	0	Home Cmplt Run
	Alarm code	0	(Reserved) (Reserved)
(Inputs (PIO Pat	tern=0)	Outputs(PIO Pattern=0)
	Name	Status	Name Status
	Pos.No1	ON	(Unused) OFF
	Pos.No2	ON	(Unused) OFF
	Pos.No4	ON	(Unused) OFF
	HOME	OFF	(Unused) OFF
	(Unused)	OFF	(Unused) OFF
	(Unused)	OFF	(Unused) OFF
	Start	OFF	PEND ON
	(Unused)	OFF	HEND OF F
	(Unused)	ON	ZONE OFF
	*STP	ON	*ALM ON

Note) While an emergency stop is actuated, the following outputs are not shown even when the controller supports these functions:

Moving

Battery alarm

Fig. 7.1 Status Monitor

The currently selected PIO pattern number is displayed only when the controller supports the "PIO pattern selection function" (parameter).

* The displayed input and output port names will vary depending on the value set in the PIO pattern selection parameter.



7-2 Controller Error List

To monitor the controller error list, click **Monitor** and then select **CTR Error List** from the main menu, or click in the toolbar. In the "Select axis number" window, select the axis number corresponding to the axis whose controller error list you want to monitor. (Refer to 4, "Selecting an Axis.")

E-Con⁻

ECTL error list[Axis No.0]	CTL error list[Axis No.0]					
B 🖹 🗾						
Data type	Code	Message				
Warning code detected last	70	RUN-OFF, Motion Command				
Error code detected last	E8	No A and B Pulse Feedback				
Error code(History 1)	BE	Homing Time Out Error				
Error code(History 2)						
Error code(History 3)						
Error code(History 4)						
Error code(History 5)						
Error code(History 6)						
Error code(History 7)						
Address of data which includes abnormal data while executing it 00000000h						

Fig. 7.2 Controller Error List Window

(1) Error list

The last detected warning code, last eight error codes and address of data in which runtime error was detected (provided as reference data for manufacturer) are shown.

(2) Toolbar



- Fig. 7.3 Toolbar
- [1] Save as

Save the error list to a file (CSV format).

* The saved file cannot be read in this application.

- [2] Print Print the error list.
- [3] Refresh

Acquire the error list from the controller again to refresh the information displayed in the window.



7-3 Velocity/Current Monitor Window

To monitor velocity/current, click **Monitor** and then select **CTR Error List** from the main menu, or click in the toolbar. In the "Select axis number" window, select the axis number corresponding to the axis whose velocity/current you want to monitor. (Refer to 4, "Selecting an Axis.") The software will start monitoring velocity/current when **i** is clicked.

E-Con

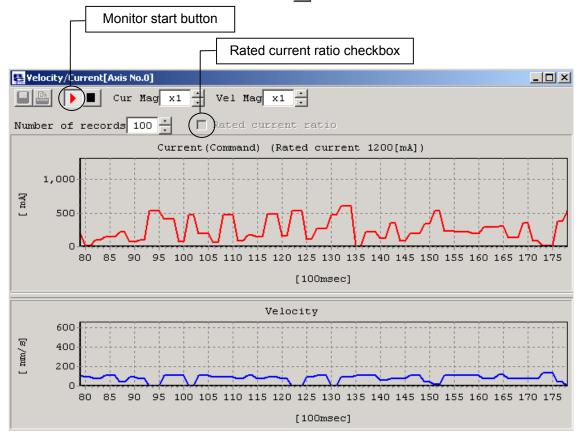


Fig. 7.4 Velocity/Current Monitor Window

- * The RCP, RCS and E-Con series do not support this function. It is supported by the RCP2 and ERC series.
- (1) Current data display
 - [1] Current (command value) display (When the **Rated current ratio** checkbox is not selected) The vertical axis represents current (command value) [in mA], while the horizontal axis represents elapsed time after the start of monitoring [in 100's of msec].
 - [2] Rated current ratio display (When the **Rated current ratio** checkbox is selected) The vertical axis represents rated current ratio [in %], while the horizontal axis represents elapsed time after the start of monitoring [in 100's of msec].

(2) Velocity data display

 
The vertical axis represents velocity [in mm/s], while the horizontal axis represents elapsed time after the start of monitoring [in 100's of msec].

Current data and velocity data are acquired from the controller at the intervals of approx. 100 msec. Therefore, changes in current/velocity occurring within these intervals cannot be monitored accurately.

BROBO CYLINDER E-Con

(3) Toolbar





[1] Save as

Save the displayed current data and velocity data to a file (CSV format).

- * Only the range of data displayed in the data display area will be saved.
 - * The saved file cannot be read in this application.
- [2] Print Print the displayed current and velocity data.
- [3] Monitor start button Start monitoring.
- [4] Monitor stop button Stop monitoring.
- [5] Vertical axis magnification change button (current) Change the vertical axis magnification in the current data display area.
- [6] Vertical axis magnification change button (velocity) Change the vertical axis magnification in the velocity data display area.



7-4 Setting of Application Window

Click Setup from the main menu, and then select Application Setup.

Setting of application	×							
Port C COM1 C COM5	Baudrate (bps) C 9600 C 38400							
€ COM2 € COM6	C 14400 C 57600							
С СОМЗ С СОМ7	C 19200 @ 115200							
C COM4 C COM8	C 28800							
Last axis # 15 - (The new settings will be effective after resetting or cycling power.)								

E-Con

Fig. 7.6 Setting of Application Window

[1] Port

From the list, select the serial port to be used to communicate with the controller.

[2] Baudrate (bps)

From the list, select the baudrate the software will use when communicating with the controller.

- * The baudrate selected here is used only in the communication between this application and controller. It does not affect the communication speed parameters of the controller.
- [3] Last axis #

Select the axis number of the last axis to be checked for connection.

* Axes of numbers greater than the value selected here will not be checked for connection. Select an appropriate axis number after checking the axis numbers of the connected axes.

Changing any of the items in [1] to [3] and then clicking **OK** will display the re-connection confirmation window shown in Fig. 7.7. To reflect the change, click **Yes** to reconnect the axes.



* The change will become effective once the application is restarted or the axes are reconnected.



Fig. 7.7 Re-connection Confirmation Window



8. Version Information

Version			×
IAI		L.1.0-E [200	for RC/E-Con 4/08/26]
Axis No.	Version	M-Info.0	M-Info.1 🔺
0	AD01000Dh	00000000h	00000000h
1			
2			
3			•
			OK

Fig. 8.1 Version Information

- [1] Application version The version of this application is shown.
- [2] Controller version The software version and manufacturing information of each connected controller are shown. (Manufacturing information may not be displayed depending on the controller type.)



9. File Extensions

Model name	Position data file	Parameter file	Backup file
RCP	*.ptr	*.pmr	*.bkr
RCS	*.ptr	*.prr	*.bur
E-Con	* pte	*.pre	*.bue
RCP2	*.ptr2	*.pmr2	*.bkr2
ERC	*.ptre	*.pmre	*.bkre

Table 2 List of File Extensions



IAI America, Inc.

Head Office: 2690 W. 237th Street, Torrance, CA 90505 TEL (310) 891-6015 FAX (310) 891-0815 Chicago Office: 1261 Hamilton Parkway, Itasca, IL 60143 TEL (630) 467-9900 FAX (630) 467-9912 New Jersey Office: 7 South Main St., Suite-F, Marlboro, NJ 07746 TEL (732) 683-9101 FAX (732) 683-9103

Home page: www.intelligentactuator.com

IAI Industrieroboter GmbH

Ober der Röth 4, D-65824 Schwalbach am Taunus, Germany TEL 06196-88950 FAX 06196-889524

The information contained in this document is subject to change without notice for the purpose of product improvement. Copyright © 2004. Jul. IAI Corporation. All rights reserved.